

MV Skarven: insufficient deck maintenance, crack and holes in superstructure, fire dampers in bad condition or missing, etc.